


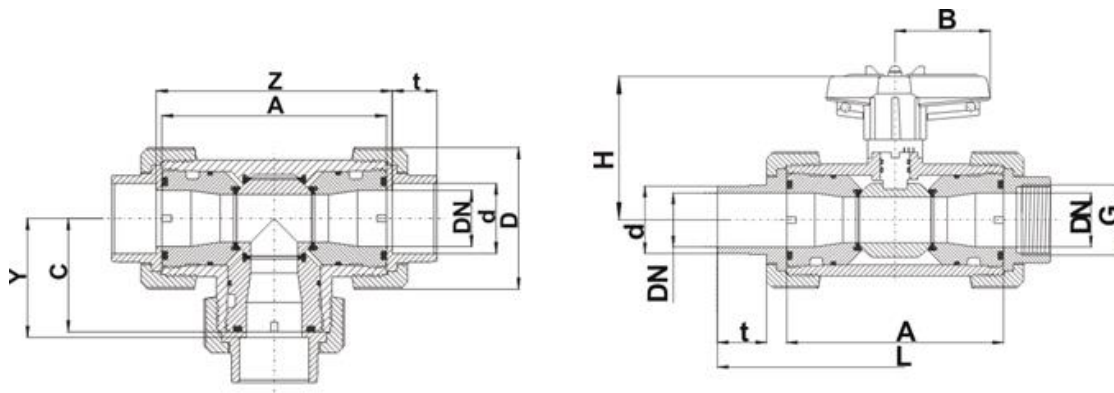

d	DN	G	A	B	C	D	H	t Schweißstutze n, -muffe	L Schweißmuffe	L schweißstutzen	L Gewindemuffe	Y	Z	PN
16	10	3/8"	98	40	49	53	72	13	136	150	136	55	110	10
20	15	1/2"	98	40	49	53	72	14,5	136	160	136	53,5	107	10
25	20	3/4"	118	51,5	59	71	81,5	16,5	163	190	163	65,5	131	10
32	25	1"	118	51,5	59	71	81,5	18	168	196	168	66	132	10
40	32	1 1/4"	159	73	79,5	100	107,5	20,5	220	247	220	89,5	179	10
50	40	1 1/2"	159	73	79,5	100	107,5	23,5	229	256	229	91	182	10
63	50	2"	177	85	88,5	120,5	116,5	27,5	263	289	263	104	208	10